


ATTENTION: RECHARGEABLE BATTERY,  
FOR 500 HOURS CONTINUOUS WORKING



**2503-101F**

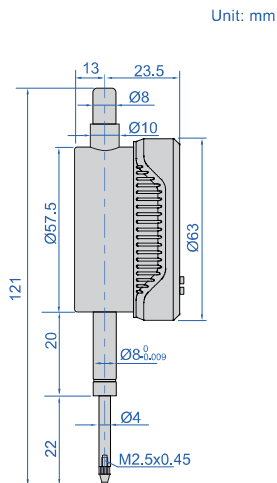

## DIGITAL INDICATOR

analog pointer

analog pointer



alarm when over tolerance

over upper limit




within tolerance



over lower limit



max./min./TIR



spindle lift knob is  
included



- Reading in digital and analog
- Button function: on/off, zero, data preset, tolerance Go and No-Go display, inch/metric conversion, measuring direction change, max./min./TIR measurement, absolute/incremental measurement
- Automatic power off (time is adjustable)
- Keep preset data and tolerance data in memory after restart
- Real-time data output (text format, virtual com port)
- Power: rechargeable Li-battery
- Optional accessory: contact points

Code	Range	Resolution	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2503-101F*	12.7mm/0.5"	0.001mm/0.00005"	3μm	2μm	1.5N	cannot lift	flat back

\*Supplied with manufacturer inspection certificate